

ISTA 6 - Amazon.com – Over Box Test Report_External

VERSION DATE: 10/11/2018

ITEM INFORMATION

Vendor/Seller Name: Victoria's Secret & Co

ASIN:

Item: TEEC Bundle: 8.4oz Mist & 8.4oz Lotion



Certification Passed: ☒ Pass / Prep Free Packaging (PFP) **All items must pass for certification*
☐ Fail / Enforced Over Box (EOB)

LAB INFORMATION

Testing Lab: Onyx Packaging Corporation

Location: New Albany, Ohio

Date of Test: 10/04/2023

ISTA Member/ Lab Tech: Mary Kate (Sovran) Glaze

TEST RESULTS

Shipment Configuration	Less Than 15lbs (6.80kg)		15lbs (6.80kg) Or Greater	
	Non Fragile	Fragile	Non Fragile	Fragile
Single		2		
Multi		3		
Total Samples		5		

Post Test Comments:

Overview	Samples were deemed acceptable under the Customer's Pass/Fail/Acceptable Criteria. Carton/Packer displayed evidence of crushing & very minor tearing on the tab to Hold the Mist Down. Note: with the tab being crushed there is still not enough space for the Mist Cap to become detached so the tab is serving its purpose.
Product Condition	Approved Under TAMU (Customer's Pass/Fail/Acceptable Limits): Very Minor Mist Label Scuffing: 5/5, 100% Very Minor Mist Cap Denting: 1/5, 20% All Lotions Passed
Packaging Condition	Shippers displayed evidence of corner & edge crushing. Carton/Packer displayed evidence of crushing & tearing. Note, there was no mist cap lifting.

Internal Doc ID #:

Date: 10/05/2023

LAB TEST REQUEST {filled out by requestor}

Test Requestor	Christopher Holtz
Project Name	PINK Bundle
Submission Date	10/04/2023
Due Date	10/05/2023

ASIN	Manufacturer	Description
	Victoria's Secret & Co	TEEC Bundle: 8.4oz Mist & 8.4oz Lotion

Package Dimension	Single Item Shipment: 10" x 7" x 3" & Multi Item Shipment: 13" x 9" x 4"
Package Weight	Single Item Shipment: 1.9 lbs & Multi Item Shipment: 6.3 lbs
Classification 1	PFP
Classification 2	Parcel
Test Type	ISTA 6 –Amazon.com Over Box
Fragile/Non-Fragile	Fragile/Liquid
Value Add Packaging (VAP)	No
Value Add Packaging (VAP) Info	
Total Test Samples	5
Additional Notes	

PRE-TEST INSPECTION {filled out by lab}

Product Condition	Items were in good condition prior to testing
Package Condition	New - All Units were re-packaged at Onyx prior to testing
Package Condition before testing	☐ ORIGINAL as arrived in the lab for testing ☒ NEW re-packaged with new materials before testing
Corrugated Info (Box Cert if available)	Single Item Shipment: 29 ECT C-Flute & Multi Item Shipment: 32 ECT C-Flute Packer/Carton: 32 ECT B-Flute
Dunnage Info	Single Item Shipment: Air Pillows Multi-Item Shipment: Air Pillows & Hazard Blocks (A,C,D)
Additional Notes	All Products were shipped from Customer's Distribution Center

PRE-TEST PICTURES

The least pristine ASIN pack should have 2 isometric pictures taken of the ASIN package as prescribed below. Special call outs and or damage should have description of location and detailed information in the text box below the picture. If a box cert is present, a picture of it should be taken and recorded.

-Please note only one set of pre-test pictures are needed for the single and multi pack out orientation.-

		
ISO #1 Side 1/2/5	ISO #2 Sides 3/4/6	Box Cert (If Applicable)

	
Pre Test Before Dunnage in Box Single	Pre Test After Dunnage in Box Single
	
Pre Test Before Dunnage in Box Multi	Pre Test After Dunnage in Box Multi

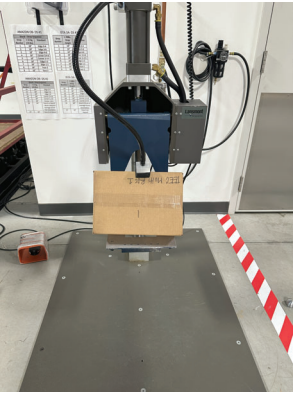
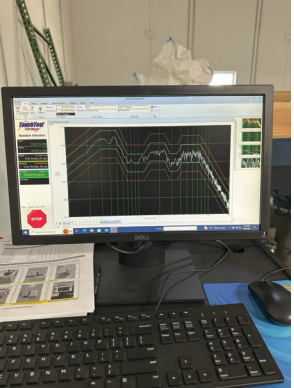
TEST DETAIL

Items in black were completed and values updated.

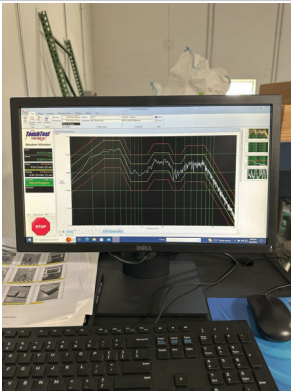
Test	Value	P/F	P/F	P/F	P/F	P/F	OBSERVATIONS
BLOCK 1:Temp and Humidity	Passed	P	P	P	P	P	Ambient Lab Temp 12+ hours
BLOCK 2: Drop 1-7	Passed	P	P	P	P	P	
BLOCK 2: Drop 8	Passed	P	P	P	P	P	
BLOCK 2: Drop 9	Passed	P	P	P	P	P	
BLOCK 3: Vib Face 3	Passed	P	P	P	P	P	
BLOCK 3: Vib Face 4	Passed	P	P	P	P	P	
BLOCK 3: Vib Face 6	Passed	P	P	P	P	P	
BLOCK 4: Drop 10-15	Passed	P	P	P	P	P	
BLOCK 4: Drop 16	Passed	P	P	P	P	P	
BLOCK 4: Drop 17	Passed	P	P	P	P	P	
BLOCK 5: Leak Test	Pass/Fail	P	P	P	P	P	

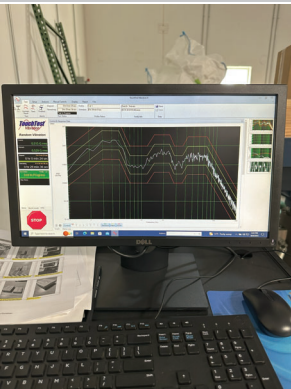
TEST PICTURES

Pictures should be taken of each block test set up along with a post picture taken of the item at the end of each test block. Additional pictures of damage should have locations noted, size of damages measured, and written in text box below them.

		
Block 2 Test Set Up	Block 2 Post Test Item Picture	Corner & Edge Crushing
		
Block 3 Face 3 Test Set up	Block 3 Face 3 Post Test Item Picture	Block 3 Face 3 Test Vibration Profile

TEST PICTURES {continued}

		
Block 3 Face 4 Test Set up	Block 3 Face 4 Post Test Item Picture	Block 3 Face 4 Test Vibration Profile

		
Block 3 Face 6 Test Set up	Block 3 Face 6 Post Test Item Picture	Block 3 Face 6 Test Vibration Profile

		
Block 4 Test Set Up	Block 4 Post Test Item Picture	

TEST PICTURES {continued}

		
Block 5 Test Set Up	Block 5 Post Test Item Picture	

POST TEST PICTURES

Pictures in the section should be taken in the following order; box is open with dunnage still in place, dunnage removed, and finally isometric view pictures of the ASINs should be taken as called out as in the two picture spots state below. An exploded bill of material (BOM) view of the item when applicable as the last mandatory picture. Additional pictures of damage should have locations noted, size of damages measured, and written in text box below them.

–PLEASE COMPLETE SECTION FOR EACH ASIN TESTED

		
ISO #1 Side 1/2/5	ISO #2 Sides 3/4/6	Post Test with dunnage in box

POST TEST PICTURES {continued}

		
Post Test dunnage removed from box	Post Test with dunnage in box	Post Test dunnage removed from box
		
Exploded BOM View	Very Minor Cap Dent	Very Minor Label Scuffing
		
Tab Crushing	Tab Crushing & Tearing	Tab Crushing

END OF REPORT